SELLI



27 NOV 1963

HFS

SECRET 270001Z

OUT 52365

1963 NOV 27 ØØ 1ØZ

CJS _

CPC-

PHS

ACT

 
Grace (File)

- SECRET. FROM NATIONAL PHOTOGRAPHIC INTERPRETATION CENTER.
- 1. CAMERA B 12 WAS USED IN MISSION 3241 FLOWN ON 16 NOVEMBER 1963: PROCESSING WAS ACCOMPLISHED BY EASTMAN KODAK.
 - 2. ORIGINAL NEGATIVE:
 - A. THE RESOLUTION IS GOOD AND THE EXPOSURE IS ADEQUATE.
- 9R SIDE: A MINUS DENSITY STREAK IS PRESENT Ø.7" FROM В. AND ROUGHLY PARALLEL TO THE INBOARD EDGE OF THE FILM FOR THE FIRST 1144 FRAMES. A THIN SCRATCH APPEARS Ø.85" FROM AND PARALLEL TO THE INBOARD EDGE OF THE FILM. THIS SCRATCH BEGINS AT A SMALL EMULSION LIFT ON FRAME 296 AND END AT A MANUFACTURER'S SPLICE ON FRAME 1114. THIS LIFTED EMULSION IS BELIEVED TO BE THE SOURCE OF THE SCRATCH. THERE IS ANOTHER MANUFACTURER'S SPLICE ON FRAME MANY PINHOLES ARE NOTED INTERMITTENTLY THROUGHOUT THE 1044. MISSION, EXAMPLES ARE ON FRAME 114, 296, 330, 348, 350, 403, THERE IS A FOGGED PATCH (POSSIBLY A LIGHT LEAK) ON 484. FRAME 1041. THIS PATCH IS ADJACENT TO THE OUTBOARD EDGE APPROX-IMATELY 1.0" IN DIAMETER AND IN THE VICINITY OF THE VERTICAL IN-DICATOR DOT.
 - C. 9L SIDE: PRESSURE ROLLER STATIC (CHATTER) IS NOTED

Declassification Review by NGA/DoD

25X1





ALONG THE INBOARD EDGE OF THE FILM FOR APPROXIMATELY THE FIRST THIRD OF THE MISSION. EMULSION DEFECTS ARE NOTED ON FRAMES 160, 161, 218, 270, 345, 1124, 1169, 1578 AND 1586.

- D. BOTH SIDES: THERE ARE 2030 TITLED FRAMES ON EACH SIDE OF THIS MISSION.
- E. NO CAMERA MALFUNCTIONS OR PROCESSING FAULTS WERE ENCOUNTERED.
 - 3. POSITIVE:
- A. PI SUITABILITY IS FAIR TO GOOD WHERE NOT DEGRADED BY CLOUDS.
 - B. PRINTING AND PROCESSING ARE GOOD.
- C. CLOUDS OBSCURE APPROXIMATELY 25 PER CENT OF THIS MISSION.
 SECRET

-END OF MESSAGE-